

FORD:

2015 Mustang

ISSUE

Some 2015 Mustang Coupe vehicles built on or before 11/10/2014 may exhibit a wind noise from the area of the upper windshield. This may be caused by a sealer skip at the front edge of the roof ditch joint resulting in a pinhole.

ACTION

Follow the Service Procedure steps to correct the condition.

SERVICE PROCEDURE

1. Check the front edge area of the roof ditch joint at the upper windshield for a pinhole or sealer skip. Is a pinhole or sealer skip evident? (Figure 1)

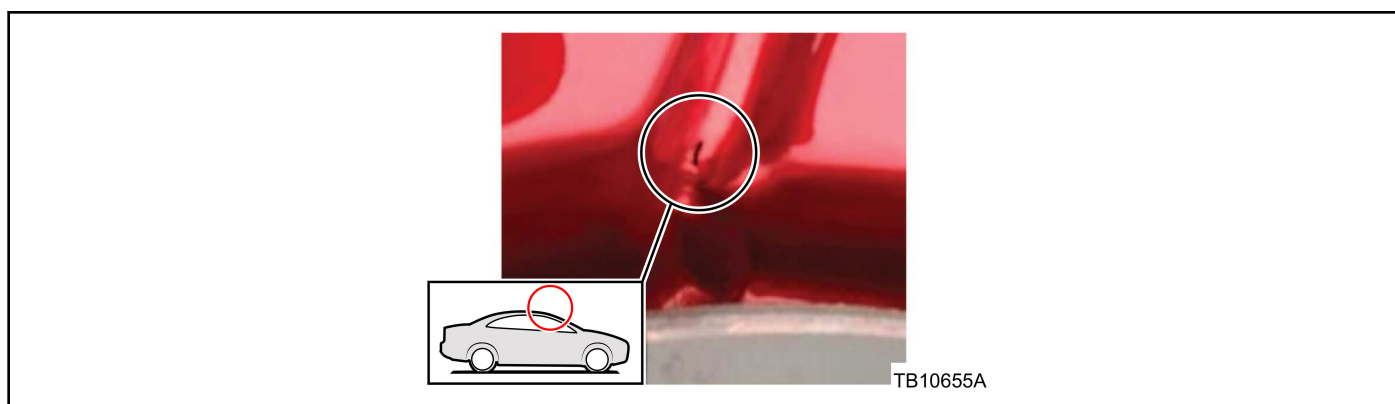


Figure 1 - Article 15-0025

- a. Yes - proceed to Step 2.
 - b. No - this article does not apply. Refer to Workshop Manual (WSM), Section 501-00 for normal diagnosis.
2. Apply Motorcraft® Seam Sealer or equivalent paintable sealer and apply the appropriate color touch up paint.

PART NUMBER	PART NAME
TA-2-B	Motorcraft® Seam Sealer (Black)
19500	See Parts Catalog (Touch Up Paint)

OPERATION	DESCRIPTION	TIME
150025A	2015 Mustang: Inspect, Apply Seam Sealer And Touch Up Paint Includes Time For Both (2) Sides Of The Vehicle If Necessary (Do Not Use With Any Other Labor Operations)	0.3 Hr.

WARRANTY STATUS:

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.

DEALER CODING

BASIC PART NO.	CONDITION CODE
6350202	68